



Non-Contact Thermometer

THERMO-HUNTER®

BUILT-IN2

BF-30I-A

[Measuring Temperature Range : 400 to 1200°C]

Wide Range Measurement

400 to 1200°C



2 · 5 · 10m

3 types of fiber length



4-20mA

Analog Output with
scaling function



M16

Compact
Sensor Head



150°C

Heatproof
(Sensor Head)



**Teach
function**

Teach function

Features

■ Reliable Functions

- 400 to 1200°C Wide Range Measurement
- 4 to 20mA Analog Output with scaling function
- ϵ -TEACH function for automatic emissivity adjustment
- High-speed response time 50ms / 90%

■ Tough and Heavy-Duty


- Sensor head withstands up to 150°C (302°F) ambient temperature without the need for additional cooling
- Compact design allows installation in small confined spaces
- Tough fiber optic cable assembly for harsh environments
- 3 fiber optic cable lengths are available (2m Standard, 5 and 10m optional)

Dimensions


Unit [mm]

Main Unit

(with BFL-30/Standard lens)

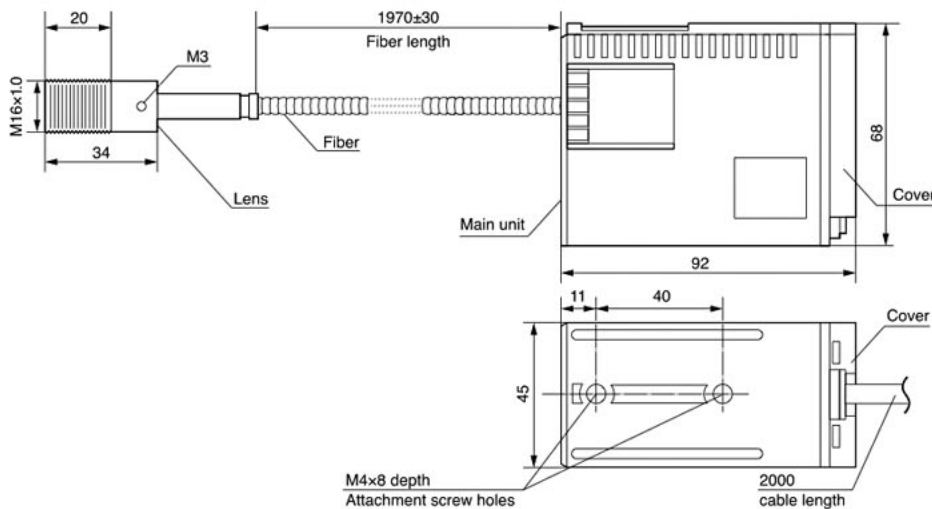


(without lens)



Field of View

Unit [mm]

BFL-30/standard lens

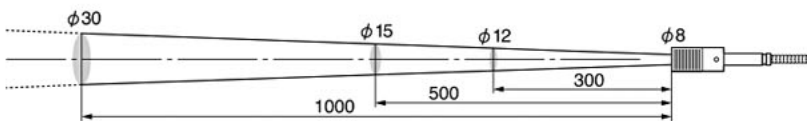


※Calibration at the factory is done with BFL-30 standard lens.

The optical resolution values stated in "Field of View" are at minimum 90% energy.

The size of measuring object should be sufficiently larger than the field of view (spot size) shown in the above illustration.

without lens

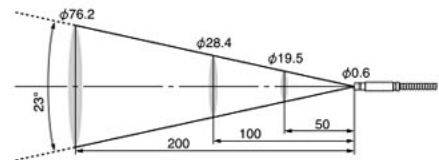

Specifications

Model	BF-30I-A
Measuring temperature range	400-1200°C
Area size	φ30 / 1000mm
Optics	Infrared sensor head
Spectral response	InGaAs / 1.2-2.6μm
Response speed	50ms / 90%
Accuracy	±2% of reading value
Repeatability	±1°C
Display resolution	1°C
Analog output	4-20mA
Output resolution	0.1-0.5°C (Depending on the setting value (100-800°C) of "High Limit"- "Low Limit")
Emissivity ratio (ε) adjustment	0.10-1.20
Delay function	Normal 1-200 variable
Power supply	DC12-24V±10% / MAX100mA
Ambient temperature	0-50°C (32-122°F) (Amplifier unit) 0-150°C (32-302°F) (Sensor head)
Environmental humidity	35-85%Rh (without dew condensation)
Storage temperature	-10 to +60°C (14 to 140°F)
Vibration resistance	10-55Hz, amplitude 1.5mm, two hours each in the direction of X, Y, Z
Water resistance	IP65
Materials	Ring, Case : glass-containing PBT, Rear : PSF, Cover : PC, Fiber : SUS, Lens attachment : BS/Ni-M
Weight	500g
Accessories	Attachment×1, M4 screw×2, Nut for lens (M16)×2

※ Design and specification are subject to change for product improvement without prior notice.

Cautions

This product is made from Glassfiber and extremely sensitive to shock and bending. The followings are the instruction so you would not break the fiber optics by rough treatment.

1. DO NOT PULL THE FIBER.
2. DO NOT GIVE SHOCK.
3. BENDING RADIUS= min.50mm

Safe Usage

This user's manual contains various warnings to ensure safe usage of the product and prevent damage and injury to you and other persons. Please be sure to heed the warnings and strictly follow safety procedures.

- ⚠ This symbol signifies a prohibited action.
- Ⓞ This symbol signifies a required action.

Environmental Warnings

- ⚠ **KEEP THE THERMOMETER AWAY FROM DIRECT SUNLIGHT, DUST, HIGH TEMPERATURES AND HIGH HUMIDITY DURING USE AND STORAGE.**
Otherwise, the optical lens will become dirty or damaged. Such usage or strage will result in incorrect measurements.
- ⚠ **DO NOT APPLY SUDDEN CHANGE OF ENVIRONMENTAL TEMPERATURES TO THE THERMOMETER.**
Sudden temperature changes of environments may cause incorrect measuring results. In such cases, leave the thermometer for a moment to let it return to a stable condition prior to the next measurements.
- ⚠ **KEEP THE THERMOMETER AWAY FROM PRODUCTS WHICH PRODUCE STRONG ELECTROMAGNETIC WAVES. DO NOT USE IN AN ATMOSPHERE CONTAINING CORROSIVE GASES OR EXPLOSIVE GASES.**
Usage in such environments will cause irreparable damages to the unit and incorrect measurements.

Usage Warnings

- Ⓞ **AVOID MEASURING SHINY OBJECTS.**
Shiny objects reflect surrounding temperatures. The emissivity rate of the unit can be adjusted to compensate for this problem.
- Ⓞ **DO NOT USE WITH NON-STANDARD VOLTAGE.**
Using the unit out of DC 12-24V range may result in damage to the unit, shorts, fires and injuries. In such cases, immediately switch the unit off.
- Ⓞ **DO NOT TOUCH TO THE OBJECT THAT IS BEING MEASURED.**
The unit is a non-contact thermometer. Touching the unit to objects with high temperatures will result in irreparable damages in the shape of the unit and incorrect measurements.
- Ⓞ **DO NOT TOUCH THE LENS.**
Do not touch the lens with hard or sharp objects. Do not insert foreign objects into the light receiving part. Otherwise, damage to the lens or incorrect measurements will occur.
- ⚠ **DO NOT USE NEAR ELECTRIFIED OBJECTS.**
Otherwise, irreparable damages or incorrect measurements will result.

Note On Export

Please note that the fiber, which is the material of this product, falls under the regulated item of the Export Trade Control Order.

TASHIKA BOEKI SHOKAI K.K.

1-12, Kaiyo-cho, Ashiya, 659-0035, JAPAN

Tel: + 81-797-23-9035 Fax: + 81-797-23-2105 e-mail: sales@tashika.co.jp URL: www.tashika.co.jp

