Specification Document

Water leakage detection sensor cable

Color-changing Water Leakage Sensor AD-HS

TASHIKA CO., LTD.

1-12, Kaiyo-cho, Ashiya, 659-0035, JAPAN

Tel: + 81-797-23-9035 Fax: + 81-797-23-2105 e-mail: sales@tashika.co.jp

URL: www.tashika.co.jp

<<<Important safety instructions>>>

Warning

Improper handling of the sensor in non-compliance to any of the following warning precautions or instructions given on a WARNING label can result in death, serious injury, fire, electric shock, and/or sensor failure.

. Warning Precautions	

Strictly Prohibited!

□Never use the sensor as electric cable.

Confirm !

- □The sensor length must not exceed 100 m per circuit.
- □ Handle the sensor carefully; it will not work if soiled or damaged.
- □ Take precautions to ensure the sensor does not become wet.
- □Before use, be sure to read the precautions on the rear of the sensor case.

_______ Caution on Installation !

- □Do not install the sensor directly on any surface where dew can form.
- □Attach the sensor as tightly as possible to the mounting surface. Any unavoidable gap such as on an uneven floor or the like horizontal surface must not exceed
 - 2 mm, and on a pillar, beam or the like vertical surface the gap must not exceed 1 mm.
- □To minimize the influence of external electromagnetic induction, the sensor comprises two electrodes twisted in a braid form. However, avoid installing the sensor over a long distance in parallel with a power cable or other electromagnetic induction sources.
- □Where the sensor intersects a power cable of 300 V or higher service voltage, surround the sensor completely with an insulating protective barrier, such as plastic molding.
- □Install the sensor so that it can be easily replaced. After detection of water leakage, the sensor is reset when the water has evaporated. However, if the sensor absorbs water that contains conductive or water-repellent material, it possibly cannot be reset and needs to be replaced.
- □ To prevent electrical corrosion of the sensor, be sure to connect it to an alternate-current water leakage detector.
- □Do not allow wax or other oil-based material on the sensor; water is repelled from the surface and may not be detected.

Table of contents

	Page
1. Scope	1
2. Construction	1
3. Specifications	2

1. Scope of application

The specification document is applicable for the color-changing type water leakage sensor (AD-HS sensor). This sensor can rapidly detect water leakage, and becomes red when absorbing water.

2. Construction

Fig. 1 and Fig. 2 show the construction of the AD-HS sensor

Electrode: 0.33 mm² tinned annealed copper wire Color changing: Ployester fibre filled with dye

Inner sheathing: Polyethylene Outer sheathing: Polyester



Fig.1: Schematic Diagram of the AD-HS Sensor

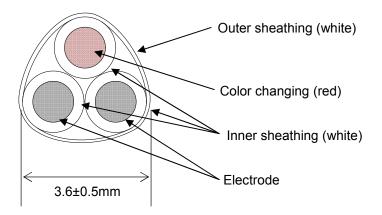


Fig. 2: Cross-section Diagram of the AD-HS Sensor

3. Specifications

The specifications of AD-HS sensor are shown in Table 1.

Table 1

Item	Specification	
Construction	Material: Tinned annealed copper stranded wire	
	Composition: Copper wire 0.18mm in diameter × 13 (0.33 mm²)	
Detection characteristic	When the amount of water (tap water) is 3.0ml or below, the electric	
	resistance between electrodes is $5k\Omega$ (AC) or below.	
	Water dropping amount: directly drop to the sensor (0.05ml/s)	
	 Measuring ambient temperature: 24℃, humidity: 60%RH 	
	 Conductivity water temperature: 24°C, 200µS/cm [5.0kΩ·cm] 	
	Testing equipment: Water leakage detector AD-AS-10DRM	
	manufactured by our company.	
	☐ The resistance between electrodes and the amount of water during	
	the sensor operation are dependent on the laying status, environment	
	and water quality of the sensor.	
Resetting characteristic	After the water leakage detection, the sensor is reset by natural	
	drying or moisture removal.	
	However, if there are conductive or water-repellent substances in the leaking water, the sensor cannot be reused.	
Resistance between electrodes (AC)	10 MΩ min. /100m (measuring ambient temperature: 24°C, humidity:	
	60%RH)	
Humidity resistance	In the high humidity condition, the resistance between electrodes is	
	100kΩ or above /100m (measuring ambient temperature: 60 $^{\circ}$ C ,	
	humidity: 95%RH) provided that there is no moisture condensation.	
	100 MΩ min. /100m (measuring ambient temperature: 60°C, humidity:	
	95%RH)	
Heat resistance	60°C max. for continuous operation (heat-resistant temperature: 80°C)	
Weight	11.6±1.5 g/m	